

KENWOOD

SB-983

SERVICE BULLETIN AMATEUR RADIO

SUBJECT

MC-48B MIC ELEMENT CHANGE

DATE

02/06/91


The original microphone element has been replaced. The new element has two connections and is much smaller than the original three connection element. When installing the new element, connect the wires as shown below. A 33K ohm, 1/4W resistor must be placed in series with the yellow wire. The rubber spacer is placed in front of the element when the microphone is assembled. The metal spacer can be discarded.

MIC ELEMENT PART # T97-1024-08

WHITE

YELLOW

BROWN

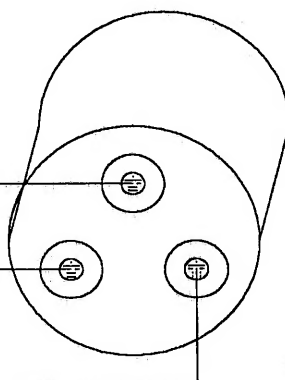


YELLOW

33K Ω

BROWN

WHITE

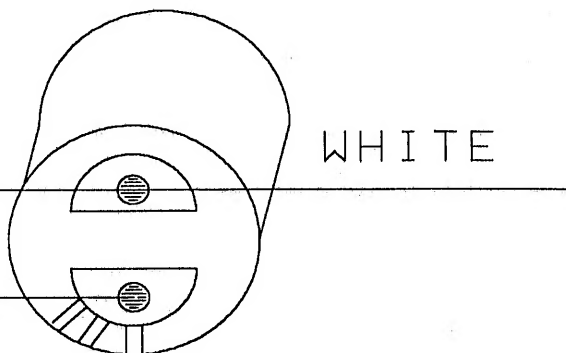

Copyright (C) 02/06/91 EWP for Kenwood U.S.A. Corporation.

KENWOOD U.S.A. CORPORATION

2201 EAST DOMÍNGUEZ STREET · LONG BEACH, CALIFORNIA 90810
MAILING: P.O. BOX 22745 · LONG BEACH, CALIFORNIA 90801-5745
TELEPHONE: (213) 639-9000